

TOLERANCE command

2397 GstarCAD MY /KW August 24, 2021 [CAD Commands](#) 0 1003

The **TOLERANCE** command is used to create a geometric tolerance in the feature control box.


Command Access:

Ribbon : Annotation > Dimension > TOLERANCE


Menu : Dimension > Tolerance

Command : TOLERANCE

Function Description:

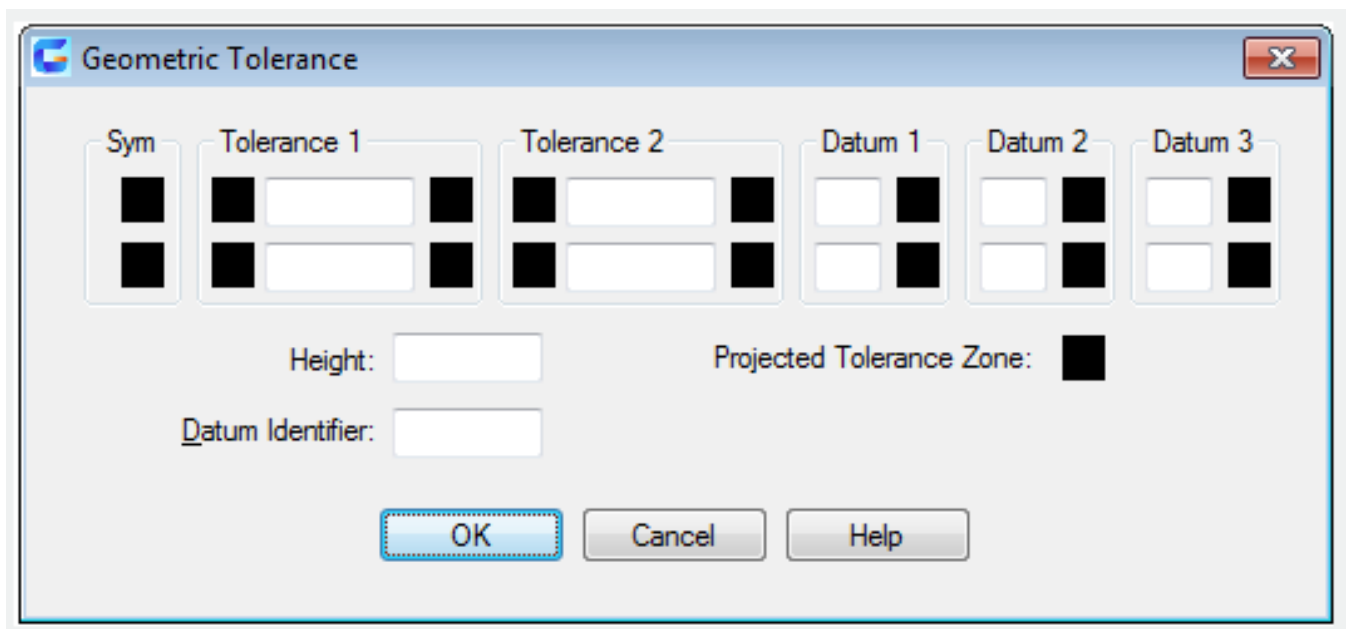

The geometric tolerance is the allowable deviation of shape, profile, direction, position and beat. The feature control box could be created by the TOLERANCE or LEADER or QLEADER command with leader.

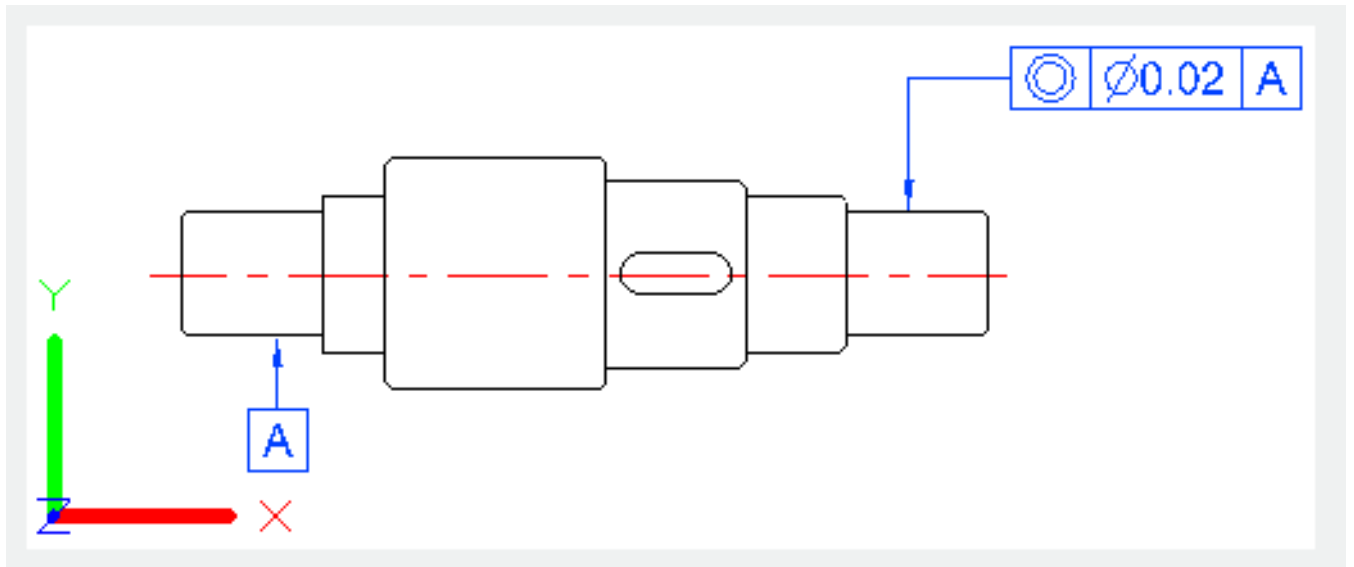

The TOLERANCE dialog box is used to specify the symbols and values for a feature control frame.


Function Description:

After selecting geometry features symbols, the Geometric Dialog box closes and prompts to specify the location to place the feature control frame.

Relative Glossary:

Symbol:

Select a geometric characteristic symbol from "Symbol" dialog box.

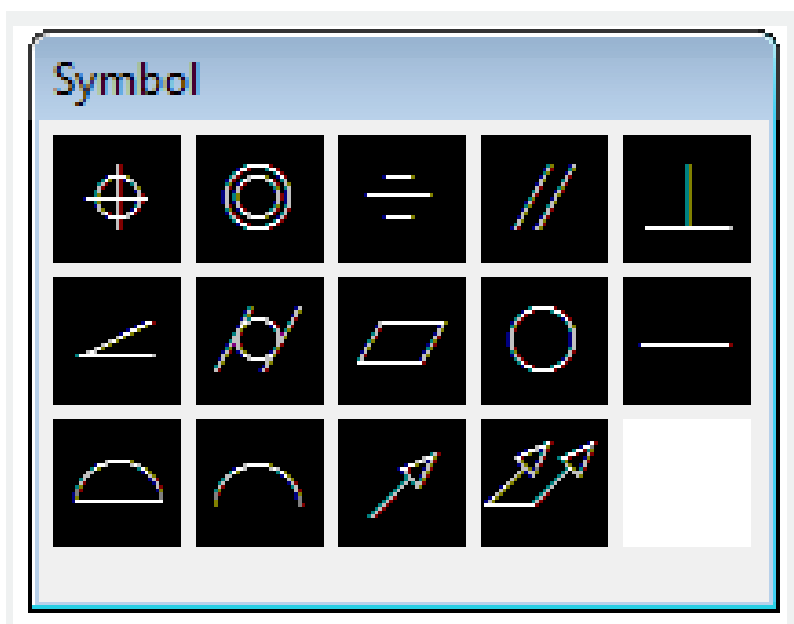


Tolerance 1:

Create the first tolerance value in the feature control frame. The tolerance value means the amount by which the geometric features can deviate from a perfect shape. Users can insert a diameter symbol.

The first box:


Click the first box to insert a symbol. For example, insert a diameter symbol.

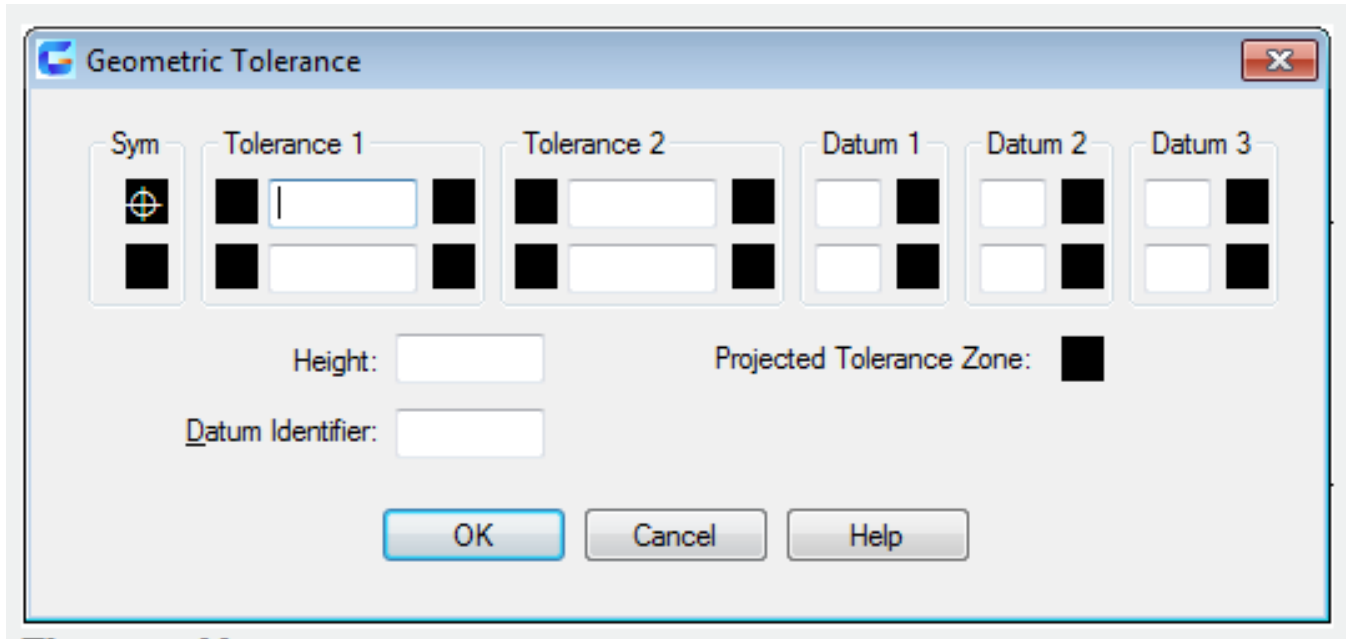

The image shows a 'Geometric Tolerance' dialog box. It has a title bar with a blue 'G' icon and a close button. The main area contains several sections: 'Sym' with a dropdown menu showing a diameter symbol; 'Tolerance 1' with a text box containing a vertical bar; 'Tolerance 2' with an empty text box; 'Datum 1', 'Datum 2', and 'Datum 3' each with a dropdown menu and a checkbox. Below these are fields for 'Height', 'Datum Identifier', and 'Projected Tolerance Zone' (with a checkbox). At the bottom are 'OK', 'Cancel', and 'Help' buttons.

The second box:



Create a tolerance value. Input a tolerance value to the second box.

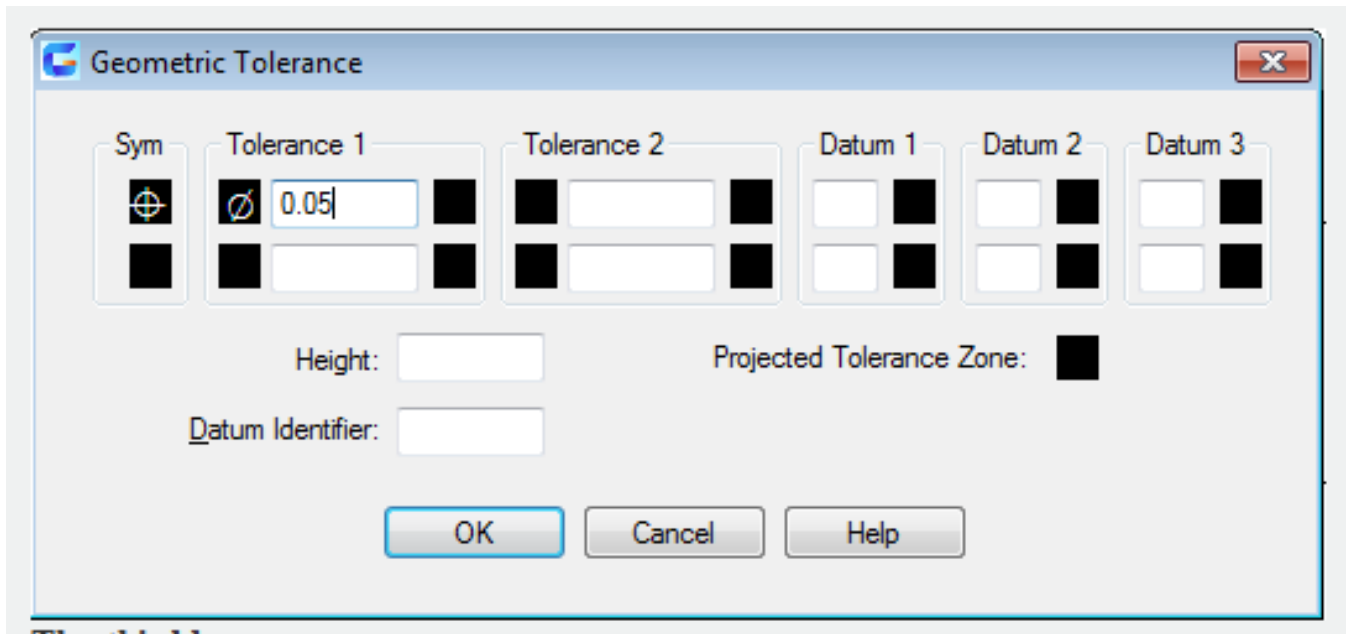

The image shows the same 'Geometric Tolerance' dialog box, but now the 'Tolerance 1' text box contains the value '0.05'. The 'Sym' dropdown still shows the diameter symbol. All other elements remain the same as in the previous image.

The third box:

Display the "Material Condition" box, from which users could select a modifying? symbol. Those symbols act as modifiers to the geometric characteristic and the tolerance value of features that can vary in size.

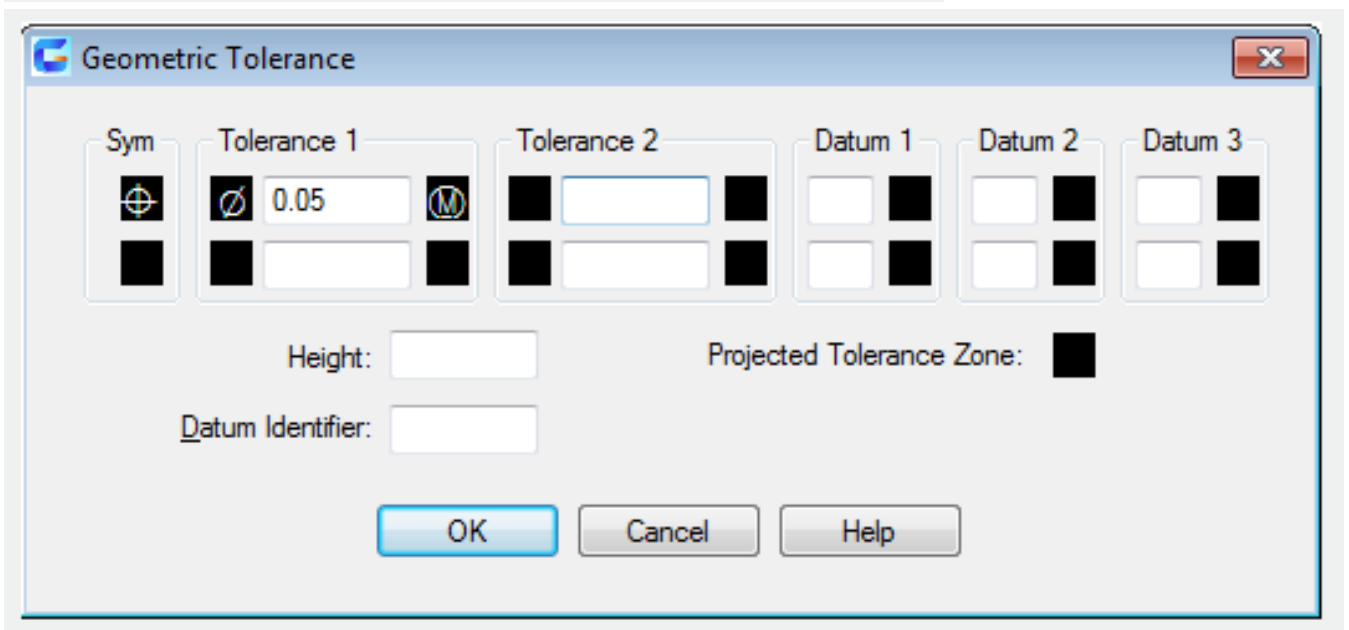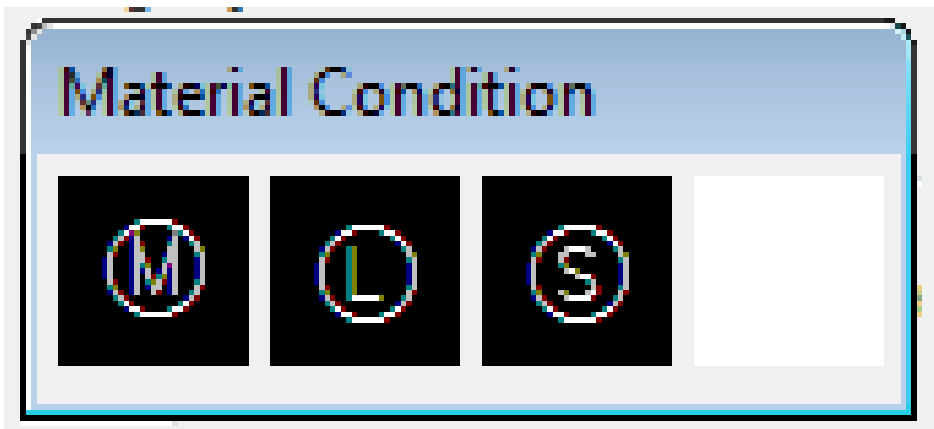

Tolerance 2:


Create the second tolerance value in the feature control box. Specify the second tolerance value in the same way as the first one.

Datum 1:

Create the primary datum reference value. The datum reference is composed by a value and a modifying symbol. In theory, the datum is an accurate geometric reference, which is a tolerance zone used to create features.


The first frame:

Create a datum reference value

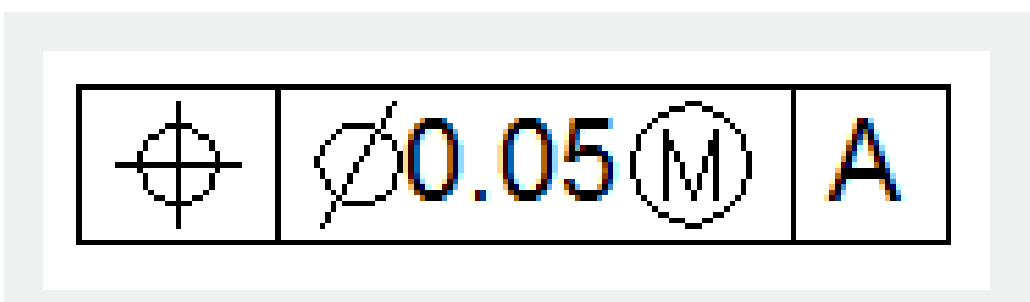


The second frame:

Display the "Material Condition" box, from which users could select a modifying symbol. These symbols act as modifiers to the datum reference.

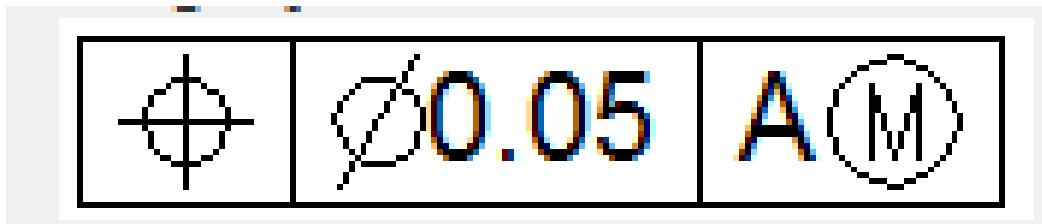


Datum 2:

Create the secondary datum reference in the feature control box, which is in the same way as the primary datum

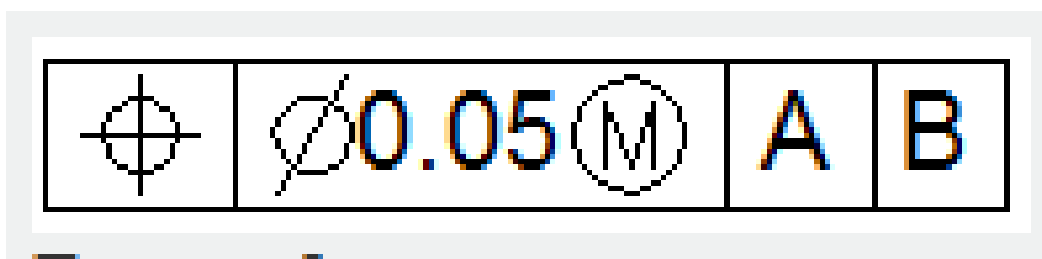


Datum 3:

Create the tertiary datum reference in the feature control box, which is in the same way as the primary datum reference.

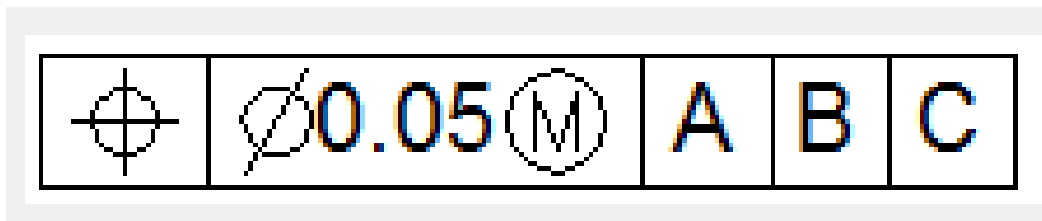


Height:

Create a projected tolerance zone value in the feature control frame. A projected tolerance zone controls the height variation of the extended portion in the fixed perpendicular part, as well the location tolerance controls the tolerance accuracy.

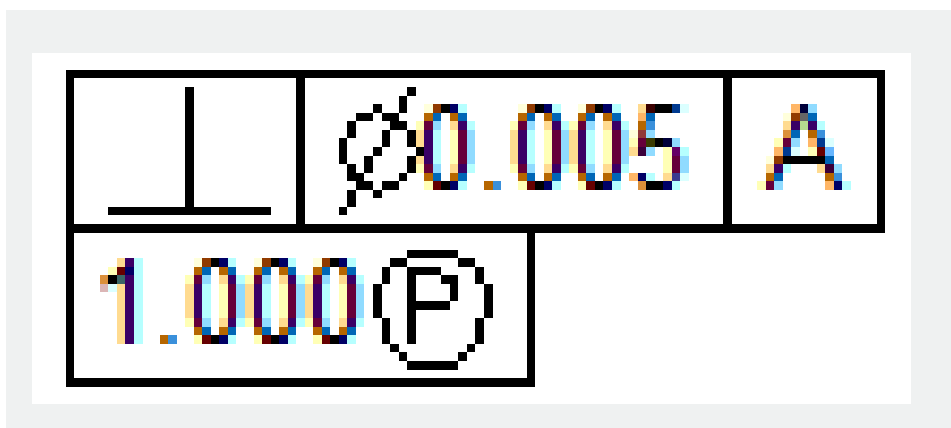


Projected Tolerance Zone:

Insert a projected tolerance zone symbol after the projected tolerance zone value.

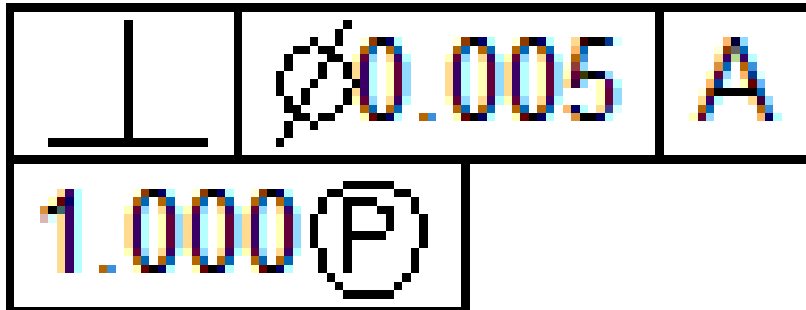

Datum Identifier:

Create a datum-identifying symbol consisting of a reference letter. A datum is a theoretically exact geometric reference from which you can establish the location and tolerance zones of other features. A point, line, plane, cylinder, or other geometry can serve as a datum.

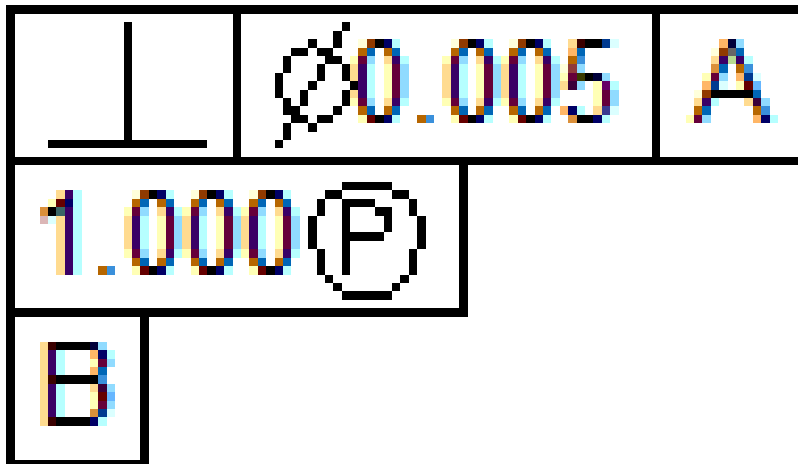

Online URL: <https://kb.gstarcad.com.my/article/tolerance-command-2397.html>